



# dsPIC33FJ64GPX06A/X08A/X10A and dsPIC33FJ128GPX06A/X08A/X10A

## dsPIC33FJ64GPX06A/X08A/X10A and dsPIC33FJ128GPX06A/X08A/X10A Family Silicon Errata and Data Sheet Clarification

The dsPIC33FJ64GPX06A/X08A/X10A and dsPIC33FJ128GPX06A/X08A/X10A family devices that you have received conform functionally to the current Device Data Sheet (DS70593C), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).

The errata described in this document will be addressed in future revisions of the dsPIC33FJ64GPX06A/X08A/X10A and dsPIC33FJ128GPX06A/X08A/X10A silicon.

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision (**A5**).

Data Sheet clarifications and corrections start on page 10, following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip's programmers, debuggers and emulation tools, which are available at the Microchip corporate web site ([www.microchip.com](http://www.microchip.com)).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with MPLAB ICD 3 or PICKit™ 3:

1. Using the appropriate interface, connect the device to the MPLAB ICD 3 programmer/debugger or PICKit 3.
2. From the main menu in MPLAB IDE, select *Configure>Select Device*, and then select the target part number in the dialog box.
3. Select the MPLAB hardware tool (*Debugger>Select Tool*).
4. Perform a "Connect" operation to the device (*Debugger>Connect*). Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

**Note:** If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The Device and Revision ID values for the various dsPIC33FJ64GPX06A/X08A/X10A and dsPIC33FJ128GPX06A/X08A/X10A silicon revisions are shown in [Table 1](#).

**TABLE 1: SILICON DEVREV VALUES**

Part Number	Device ID <sup>(1)</sup>	Revision ID for Silicon Revision <sup>(2)</sup>		
		A3	A4	A5
dsPIC33FJ64GP206A	0x00C1	0x3009	0x300A	0x300B
dsPIC33FJ64GP306A	0x00CD			
dsPIC33FJ64GP310A	0x00CF			
dsPIC33FJ64GP706A	0x00D5			
dsPIC33FJ64GP708A	0x00D6			
dsPIC33FJ64GP710A	0x00D7			
dsPIC33FJ128GP206A	0x00D9			
dsPIC33FJ128GP306A	0x00E5			
dsPIC33FJ128GP310A	0x00E7			

**Note 1:** The Device and Revision IDs (DEVID and DEVREV) are located at the last two implemented addresses in program memory.

**2:** Refer to the "dsPIC33F/PIC24H Flash Programming Specification" (DS70152) for detailed information on Device and Revision IDs for your specific device.

**TABLE 1: SILICON DEVREV VALUES (CONTINUED)**

Part Number	Device ID <sup>(1)</sup>	Revision ID for Silicon Revision <sup>(2)</sup>		
		A3	A4	A5
dsPIC33FJ128GP706A	0x00ED	0x3009	0x300A	0x300B
dsPIC33FJ128GP708A	0x00EE			
dsPIC33FJ128GP710A	0x00EF			

**Note 1:** The Device and Revision IDs (DEVID and DEVREV) are located at the last two implemented addresses in program memory.

**2:** Refer to the “dsPIC33F/PIC24H Flash Programming Specification” (DS70152) for detailed information on Device and Revision IDs for your specific device.

**TABLE 2: SILICON ISSUE SUMMARY**

Module	Feature	Item Number	Issue Summary	Affected Revisions <sup>(1)</sup>		
				A3	A4	A5
ECAN™	Sleep Mode	1.	The WAKIF bit in the CxINTF register cannot be cleared by software instruction after the device is interrupted from Sleep due to activity on the CAN bus.	X	X	X
UART	IR Mode	2.	The 16x baud clock signal on the BCLK pin is present only when the module is transmitting.	X	X	X
UART	High-Speed Mode	3.	When the UART is in 4x mode (BRGH = 1) and using two Stop bits (STSEL = 1), it may sample the first Stop bit instead of the second one.	X	X	X
UART	Interrupts	4.	The UART error interrupt may not occur, or may occur at an incorrect time, if multiple errors occur during a short period of time.	X	X	X
I <sup>2</sup> C™	10-bit Addressing Mode	5.	When the I <sup>2</sup> C module is configured for 10-bit addressing using the same address bits (A10 and A9) as other I <sup>2</sup> C devices, the A10 and A9 bits may not work as expected.	X	X	X
I <sup>2</sup> C	—	6.	After the ACKSTAT bit is set when receiving a NACK, it may be cleared by the reception of a Start or Stop bit.	X	X	X
I <sup>2</sup> C	10-bit Addressing Mode	7.	The 10-bit slave does not set the RBF flag or load the I2CxRCV register on address match if the Least Significant bits (LSBs) of the address are the same as the 7-bit reserved addresses.	X	X	X
I <sup>2</sup> C	10-bit Addressing Mode	8.	When the I <sup>2</sup> C module is configured as a 10-bit slave with an address of 0x102, the I2CxRCV register content for the lower address byte is 0x01 rather than 0x02.	X	X	X
SPI	Frame Mode	9.	In framed SPI mode, when the FRMDLY bit (SPIxCON2<1>) is cleared and SMP bit (SPIxCON1<9>) is cleared, frame sync pulses do not get generated.	X	X	X
Internal Voltage Regulator	IPD	10.	When the VREGS bit (RCON<8>) is set to a logic '0', device may Reset and higher sleep current may be observed.	X	X	X
PSV Operations	—	11.	An address error trap occurs in certain addressing modes when accessing the first four bytes of any PSV page.	X	X	X
CPU	EXCH Instruction	12.	The EXCH instruction does not execute correctly.	X	X	X
SPI	Transmit Operation	13.	Writing to the SPIxBUF register as soon as TBF bit is cleared will cause SPI module to ignore written data.	X	X	X

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

**TABLE 2: SILICON ISSUE SUMMARY (CONTINUED)**

Module	Feature	Item Number	Issue Summary	Affected Revisions <sup>(1)</sup>		
				A3	A4	A5
ECAN	Transmission Queuing	14.	ECAN module may not transmit Buffer 0 data if Buffer 1 data is queued for transmission first.	X	X	X
UART	Break Character Generation	15.	The UART module will not generate back-to-back Break characters.	X	X	X
I/O	SDO1 Pin	16.	SDO1 pin may toggle while device is being programmed via PGECx/PGEDx pin pairs.	X	X	X
ADC	Current Consumption in Sleep Mode	17.	If the ADC module is in an enabled state when the device enters Sleep mode, the power-down current (IPD) of the device may exceed the device data sheet specifications.	X	X	X
All	150°C Operation	18.	These revisions of silicon only support 140°C operation instead of 150°C for Hi-Temp operating temperature.	X	X	
Sleep Mode	Current Consumption	19.	The device power-down current (IPD) exceeds the specifications listed in the device data sheet.	X	X	
CPU	Interrupt Disable	20.	When a previous DISI instruction is active (i.e., the DISICNT register is non-zero), and the value of the DISICNT register is updated manually, the DISICNT register freezes and disables interrupts permanently.	X	X	X
CPU	div.sd	21.	When using the div.sd instruction, the overflow bit is not getting set when an overflow occurs.	X	X	X
UART	TX Interrupt	22.	A transmit (TX) Interrupt may occur before the data transmission is complete.	X	X	X
JTAG	Flash Programming	23.	JTAG Flash programming is not supported.	X	X	X

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

**Silicon Errata Issues**

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**A5**).

**1. Module: ECAN™**

The WAKIF bit in the CxINTF register cannot be cleared by software instruction after the device is interrupted from Sleep due to activity on the CAN bus.

When the device wakes up from Sleep due to CAN bus activity, the ECAN module is placed in operational mode. The ECAN Event interrupt occurs due to the WAKIF flag. Trying to clear the flag in the Interrupt Service Routine (ISR) may not clear the flag. The WAKIF bit being set will not cause repetitive Interrupt Service Routine execution.

**Work around**

Although the WAKIF bit does not clear, the device Sleep and ECAN Wake function continue to work as expected. If the ECAN event is enabled, the CPU will enter the Interrupt Service Routine due to the WAKIF flag getting set. The application can maintain a secondary flag, which tracks the device Sleep and Wake events.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**2. Module: UART**

When the UART is configured for IR interface operations (UxMODE<9:8> = 11), the 16x baud clock signal on the BCLK pin is present only when the module is transmitting. The pin is idle at all other times.

**Work around**

Configure one of the output compare modules to generate the required baud clock signal when the UART is receiving data or in an Idle state.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**3. Module: UART**

When the UART is in 4x mode (BRGH = 1) and using two Stop bits (STSEL = 1), it may sample the first Stop bit instead of the second one.

This issue does not affect the other UART configurations.

**Work around**

Use the 16x baud rate option (BRGH = 0) and adjust the baud rate accordingly.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**4. Module: UART**

The UART error interrupt may not occur, or may occur at an incorrect time, if multiple errors occur during a short period of time.

**Work around**

Read the error flags in the UxSTA register whenever a byte is received to verify the error status. In most cases, these bits will be correct, even if the UART error interrupt fails to occur.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**5. Module: I<sup>2</sup>C™**

If there are two I<sup>2</sup>C devices on the bus, one of them is acting as the Master receiver and the other as the Slave transmitter. If both devices are configured for 10-bit addressing mode, and have the same value in the A10 and A9 bits of their addresses, then when the Slave select address is sent from the Master, both the Master and Slave acknowledge it. When the Master sends out the read operation, both the Master and the Slave enter into Read mode and both of them transmit the data. The resultant data will be the ANDing of the two transmissions.

**Work around**

In all I<sup>2</sup>C devices, the addresses as well as bits A10 and A9 should be different.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**6. Module: I<sup>2</sup>C**

When the I<sup>2</sup>C module is operating in either Master or Slave mode, after the ACKSTAT bit is set when receiving a NACK, it may be cleared by the reception of a Start or Stop bit.

**Work around**

Store the value of the ACKSTAT bit immediately after receiving a NACK.

**Affected Silicon Revisions**

A3	A4	A5						
X	X	X						

**7. Module: I<sup>2</sup>C**

In 10-bit Addressing mode, some address matches do not set the RBF flag or load the receive register I2CxRCV if the lower address byte matches the reserved addresses. In particular, these include all addresses with the form XX0000XXXX and XX1111XXXX, with the following exceptions:

- 001111000X
- 011111001X
- 101111010X
- 111111011X

**Work around**

Ensure that the lower address byte in 10-bit Addressing mode does not match any 7-bit reserved addresses.

**Affected Silicon Revisions**

A3	A4	A5						
X	X	X						

**8. Module: I<sup>2</sup>C**

When the I<sup>2</sup>C module is configured as a 10-bit slave with an address of 0x102, the I2CxRCV register content for the lower address byte is 0x01 rather than 0x02; however, the module acknowledges both address bytes.

**Work around**

None.

**Affected Silicon Revisions**

A3	A4	A5						
X	X	X						

**9. Module: SPI**

In framed SPI mode, when the FRMDLY bit (SPIxCON2<1>) is cleared and the SMP bit (SPIxCON1<9>) is cleared, frame sync pulses do not get generated.

**Work around**

None.

**Affected Silicon Revisions**

A3	A4	A5						
X	X	X						

**10. Module: Internal Voltage Regulator**

When the VREGS bit (RCON<8>) is set to a logic '0', the device may Reset and a higher sleep current may be observed.

**Work around**

Ensure the VREGS bit (RCON<8>) is set to a logic '1' for device Sleep mode operation.

**Affected Silicon Revisions**

A3	A4	A5						
X	X	X						

**11. Module: PSV Operations**

An address error trap occurs in certain addressing modes when accessing the first four bytes of an PSV page. This only occurs when using the following addressing modes:

- MOV.D
- Register Indirect Addressing (word or byte mode) with pre/post-decrement

**Work around**

Do not perform PSV accesses to any of the first four bytes using the above addressing modes. For applications using the C language, MPLAB C30 version 3.11 or higher, provides the following command-line switch that implements a work around for the erratum.

```
-merrata=psv_trap
```

Refer to the `readme.txt` file in the MPLAB C30 v3.11 tool suite for further details.

**Affected Silicon Revisions**

A3	A4	A5						
X	X	X						

**12. Module: CPU**

The EXCH instruction does not execute correctly.

**Work around**

If writing source code in assembly, the recommended work around is to replace:

```
EXCH Wsource, Wdestination
```

with:

```
PUSH Wdestination
```

```
MOV Wsource, Wdestination
```

```
POP Wsource
```

If using the MPLAB C30 C compiler, specify the compiler option: `-merrata=exch` (*Project > Build Options > Projects > MPLAB C30 > Use Alternate Settings*).

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**13. Module: SPI**

Writing to the SPIxBUF register as soon as the TBF bit is cleared will cause the SPI module to ignore the written data. Applications which use SPI with DMA will not be affected by this erratum.

**Work around**

After the TBF bit is cleared, wait for a minimum duration of one SPI Clock before writing to the SPIxBUF register.

Alternatively, do one of the following:

- Poll the RBF bit and wait for it to get set before writing to the SPIxBUF register
- Poll the SPI Interrupt flag and wait for it to get set before writing to the SPIxBUF register
- Use an SPI Interrupt Service Routine
- Use DMA

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**14. Module: ECAN**

ECAN module may not transmit Buffer 0 data if Buffer 1 data is queued for transmission first. This problem is specific to transmit Buffers 0 and 1 only.

**Work around**

The issue can be fixed by setting reserved bit 11 in CiCTRL1 register to 1. Note that the module reset value for this bit is zero.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**15. Module: UART**

The UART module will not generate consecutive break characters. Trying to perform a back-to-back Break character transmission will cause the UART module to transmit the dummy character used to generate the first Break character instead of transmitting the second Break character. Break characters are generated correctly if they are followed by non-Break character transmission.

**Work around**

None.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**16. Module: I/O**

While device is being programmed via PGECx/ PGEDx pin pair, device pin with SDO1 functionality may start toggling.

**Work around**

None.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**17. Module: ADC**

If the ADC module is in an enabled state when the device enters Sleep mode as a result of executing a PWRSAV #0 instruction, the device power-down current (IPD) may exceed the specifications listed in the device data sheet. This may happen even if the ADC module is disabled by clearing the ADON bit prior to entering Sleep mode.

**Work arounds**

**Work around 1:**

In order to remain within the IPD specifications listed in the device data sheet, the user software must completely disable the ADC module by setting the ADC Module Disable bit in the corresponding Peripheral Module Disable register (PMDx), prior to executing a PWRSAV #0 instruction.

**Note:** The ADC module must be reinitialized by the user application before resuming ADC operation.

**Work around 2:**

If the ADC module was previously initialized and enabled, before entering Sleep, execute the lines of code provided in [Example 1](#).

**Note:** Unlike **Work around 1**, the user application does not need to reinitialize the ADC module; however, it is necessary to re-enable the ADC module by setting the ADON bit after waking from Sleep.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**EXAMPLE 1:**

```
AD1CON1bits.ADON = 0;           //Disable the ADC module
__asm__ volatile ("REPEAT #50"); //Wait 50 Tcy
__asm__ volatile ("NOP");       //Repeat NOP 51 times
Sleep();                        // Execute PWRSAV #0 and go to Sleep
```

**18. Module: All**

The affected silicon revisions listed below are not warranted for operation at 150°C.

**Work around**

Only use the affected revisions of silicon for Hi-Temp operating range from -40°C to +140°C.

**Affected Silicon Revisions**

A3	A4	A5					
X	X						

**19. Module: Sleep Mode**

The device power-down current (IPD) exceeds the specifications listed in the device data sheet. The actual power-down current specifications are shown in [Table 3](#).

The IPD values in [Table 3](#) were measured with all peripherals and clocks shut down, with the exception of the ADC module(s).

The following ADC settings were enabled for each ADC module prior to executing the `PWRSVAV` instruction:

- `ADON = 1`
- `VCFG = 1`
- `AD12B = 1`
- `ADxMD = 0`

All I/Os were configured as inputs and pulled to Vss. Peripherals such as the Watchdog Timer, etc., were switched off.

**Work around**

None.

**Affected Silicon Revisions**

<b>A3</b>	<b>A4</b>	<b>A5</b>					
X	X						

**TABLE 3: DC CHARACTERISTICS: POWER-DOWN CURRENT (IPD)**

DC CHARACTERISTICS			Standard Operating Conditions: 3.0V to 3.6V (unless otherwise stated) Operating temperature -40°C ≤ TA ≤ +85°C for Industrial -40°C ≤ TA ≤ ±125°C for Extended			
Parameter No.	Typical	Max	Units	Conditions		
<b>Power-Down Current (IPD)</b>						
DC60d	400	500	μA	-40°C	3.3V Base Power-Down Current	
DC60a	400	500	μA	+25°C		
DC60b	500	800	μA	+85°C		
DC60c	1000	1500	μA	+125°C		



**20. Module: CPU**

When a previous `DISI` instruction is active (i.e., the `DISICNT` register is non-zero), and the value of the `DISICNT` register is updated manually, the `DISICNT` register freezes and disables interrupts permanently.

**Work around**

Avoid updating the `DISICNT` register manually. Instead, use the `DISI #n` instruction with the required value for 'n'.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**21. Module: CPU**

When using the Signed 32-by-16-bit Division instruction, `div.sd`, the overflow bit does not always get set when an overflow occurs.

**Work around**

Test for and handle overflow conditions outside of the `div.sd` instruction.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**22. Module: UART**

When using `UTXISEL = 01` (Interrupt when last character is shifted out of the Transmit Shift Register) and the final character is being shifted out through the Transmit Shift Register, the Transmit (TX) Interrupt may occur before the final bit is shifted out.

**Work around**

If it is critical that the interrupt processing occur only when all transmit operations are complete. Hold off the interrupt routine processing by adding a loop at the beginning of the routine that polls the Transmit Shift Register Empty bit (TRMT) before processing the rest of the interrupt.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

**23. Module: JTAG**

JTAG Flash programming is not supported.

**Work around**

None.

**Affected Silicon Revisions**

A3	A4	A5					
X	X	X					

### **Data Sheet Clarifications**

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS70593C):

<p><b>Note:</b> Corrections are shown in <b>bold</b>. Where possible, the original bold text formatting has been removed for clarity.</p>
---

No issues to report at this time.

## **APPENDIX A: REVISION HISTORY**

### Rev A Document (4/2009)

Initial release of this document; issued for revision A3 and A4 silicon.

Includes silicon issues 1 ([ECAN™](#)), 2-4 ([UART](#)), 5-8 ([I<sup>2</sup>C™](#)), 9 ([SPI](#)), 10 ([Internal Voltage Regulator](#)), 11 ([PSV Operations](#)), 12 ([CPU](#)), 13 ([SPI](#)) and 14 ([ECAN](#)).

### Rev B Document (8/2009)

Added silicon issue 15 ([UART](#)) and 16 ([I/O](#)).

### Rev C Document (5/2010)

Updated silicon issue 12 ([CPU](#)).

Added silicon issue 17 ([ADC](#)) and data sheet clarification 1 (DC Characteristics: I/O Pin Input Specifications).

### Rev D Document (10/2010)

Updated the work around in silicon issue 17 ([ADC](#)).

Added silicon issue 18 ([All](#)).

### Rev E Document (3/2011)

Revised silicon revision to A5 and removed data sheet clarification 1.

Added silicon issue 19 ([Sleep Mode](#)).

### Rev F Document (4/2011)

Updated the affected revisions for silicon issue 17 ([ADC](#)).

### Rev G Document (11/2011)

Added silicon issues 20 ([CPU](#)), 21 ([CPU](#)), 22 ([UART](#)), and 23 ([JTAG](#)).

**NOTES:**

---

**Note the following details of the code protection feature on Microchip devices:**

- Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these methods, to our knowledge, require using the Microchip products in a manner outside the operating specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as “unbreakable.”

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

---

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights.

**Trademarks**

The Microchip name and logo, the Microchip logo, dsPIC, KEELOQ, KEELOQ logo, MPLAB, PIC, PICmicro, PICSTART, PIC<sup>32</sup> logo, rPIC and UNI/O are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

FilterLab, Hampshire, HI-TECH C, Linear Active Thermistor, MXDEV, MXLAB, SEEVAL and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Analog-for-the-Digital Age, Application Maestro, chipKIT, chipKIT logo, CodeGuard, dsPICDEM, dsPICDEM.net, dsPICworks, dsSPEAK, ECAN, ECONOMONITOR, FanSense, HI-TIDE, In-Circuit Serial Programming, ICSP, Mindi, MiWi, MPASM, MPLAB Certified logo, MPLIB, MPLINK, mTouch, Omniscient Code Generation, PICC, PICC-18, PICDEM, PICDEM.net, PICKit, PICtail, REAL ICE, rLAB, Select Mode, Total Endurance, TSHARC, UniWinDriver, WiperLock and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2009-2011, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

 Printed on recycled paper.

ISBN: 978-1-61341-815-4

*Microchip received ISO/TS-16949:2009 certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona; Gresham, Oregon and design centers in California and India. The Company's quality system processes and procedures are for its PIC® MCUs and dsPIC® DSCs, KEELOQ® code hopping devices, Serial EEPROMs, microperipherals, nonvolatile memory and analog products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001:2000 certified.*

**QUALITY MANAGEMENT SYSTEM**  
**CERTIFIED BY DNV**  
**== ISO/TS 16949:2009 ==**



# MICROCHIP

## Worldwide Sales and Service

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://www.microchip.com/support>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

**Atlanta**  
Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

**Boston**  
Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

**Chicago**  
Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

**Cleveland**  
Independence, OH  
Tel: 216-447-0464  
Fax: 216-447-0643

**Dallas**  
Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

**Detroit**  
Farmington Hills, MI  
Tel: 248-538-2250  
Fax: 248-538-2260

**Indianapolis**  
Noblesville, IN  
Tel: 317-773-8323  
Fax: 317-773-5453

**Los Angeles**  
Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608

**Santa Clara**  
Santa Clara, CA  
Tel: 408-961-6444  
Fax: 408-961-6445

**Toronto**  
Mississauga, Ontario,  
Canada  
Tel: 905-673-0699  
Fax: 905-673-6509

### ASIA/PACIFIC

**Asia Pacific Office**  
Suites 3707-14, 37th Floor  
Tower 6, The Gateway  
Harbour City, Kowloon  
Hong Kong  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**Australia - Sydney**  
Tel: 61-2-9868-6733  
Fax: 61-2-9868-6755

**China - Beijing**  
Tel: 86-10-8569-7000  
Fax: 86-10-8528-2104

**China - Chengdu**  
Tel: 86-28-8665-5511  
Fax: 86-28-8665-7889

**China - Chongqing**  
Tel: 86-23-8980-9588  
Fax: 86-23-8980-9500

**China - Hangzhou**  
Tel: 86-571-2819-3187  
Fax: 86-571-2819-3189

**China - Hong Kong SAR**  
Tel: 852-2401-1200  
Fax: 852-2401-3431

**China - Nanjing**  
Tel: 86-25-8473-2460  
Fax: 86-25-8473-2470

**China - Qingdao**  
Tel: 86-532-8502-7355  
Fax: 86-532-8502-7205

**China - Shanghai**  
Tel: 86-21-5407-5533  
Fax: 86-21-5407-5066

**China - Shenyang**  
Tel: 86-24-2334-2829  
Fax: 86-24-2334-2393

**China - Shenzhen**  
Tel: 86-755-8203-2660  
Fax: 86-755-8203-1760

**China - Wuhan**  
Tel: 86-27-5980-5300  
Fax: 86-27-5980-5118

**China - Xian**  
Tel: 86-29-8833-7252  
Fax: 86-29-8833-7256

**China - Xiamen**  
Tel: 86-592-2388138  
Fax: 86-592-2388130

**China - Zhuhai**  
Tel: 86-756-3210040  
Fax: 86-756-3210049

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-3090-4444  
Fax: 91-80-3090-4123

**India - New Delhi**  
Tel: 91-11-4160-8631  
Fax: 91-11-4160-8632

**India - Pune**  
Tel: 91-20-2566-1512  
Fax: 91-20-2566-1513

**Japan - Yokohama**  
Tel: 81-45-471- 6166  
Fax: 81-45-471-6122

**Korea - Daegu**  
Tel: 82-53-744-4301  
Fax: 82-53-744-4302

**Korea - Seoul**  
Tel: 82-2-554-7200  
Fax: 82-2-558-5932 or  
82-2-558-5934

**Malaysia - Kuala Lumpur**  
Tel: 60-3-6201-9857  
Fax: 60-3-6201-9859

**Malaysia - Penang**  
Tel: 60-4-227-8870  
Fax: 60-4-227-4068

**Philippines - Manila**  
Tel: 63-2-634-9065  
Fax: 63-2-634-9069

**Singapore**  
Tel: 65-6334-8870  
Fax: 65-6334-8850

**Taiwan - Hsin Chu**  
Tel: 886-3-5778-366  
Fax: 886-3-5770-955

**Taiwan - Kaohsiung**  
Tel: 886-7-536-4818  
Fax: 886-7-330-9305

**Taiwan - Taipei**  
Tel: 886-2-2500-6610  
Fax: 886-2-2508-0102

**Thailand - Bangkok**  
Tel: 66-2-694-1351  
Fax: 66-2-694-1350

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4450-2828  
Fax: 45-4485-2829

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**UK - Wokingham**  
Tel: 44-118-921-5869  
Fax: 44-118-921-5820

08/02/11