

1. Safety instructions

- To ensure sufficient convection cooling, always maintain a safety distance of $\geq 20\text{mm}$ from all ventilated surfaces while the device is in operation.
- The device is not recommended to be placed on low thermal conductive surface, for example, plastics.
- Note that the enclosure of the device can become very hot depending on the ambient temperature and load of the power supply. Do not touch the device while it is in operation or immediately after power is turned OFF. Risk of burning!
- Do not touch the terminals while power is being supplied. Risk of electric shock.
- Prevent any foreign metal, particles or conductors to enter the device through the openings during installation. It can cause: – Electric shock; Safety Hazard; Fire; Product failure
- Warning: When connecting the device, secure Earth connection before connecting L and N. When disconnecting the device, remove L and N connections before removing the Earth connection.

2. Device descriptions

Refer to Fig.1.:

- ① Input & Output terminal block connector
- ② DC voltage adjustment potentiometer
- ③ DC OK control LED (green)

3. Installation of the Device

Refer to Fig. 2.:

- (A) Mounting holes for power supply assembly onto the mounting surface. Power supply shall be mounted on minimum 2 mounting holes using M3 screw minimum 5mm length.
- (B) This surface belongs to customer's end system or panel where the power supply is mounted.
- (C) Connector

- Use flexible cable (stranded or solid), AWG no. 18-14. The torque at the Connector shall not exceed 13Kgf.cm. The insulation stripping length should not exceed 0.275" or 7mm Refer to Fig. 3.

4. Installation of Mounting Accessories

- Only use M3 screw $\leq 6\text{mm}$ through the base mounting holes. This is to keep a safety distance between the screw and internal components.
- Refer to Fig. 4.: Recommended mounting tightening torque : 4~8Kgf.cm



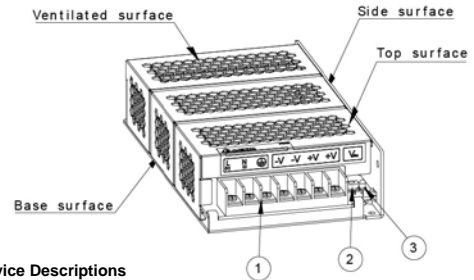


Fig. 1. Device Descriptions

Side Mounting (Vertical)

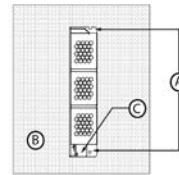

Base Mounting (Vertical)

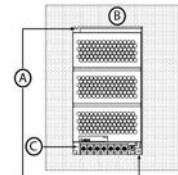

Side Mounting (Horizontal)



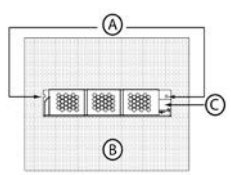


Fig. 2. Mounting Orientation



Lug



Stripped wire

Fig. 3. Wire Type

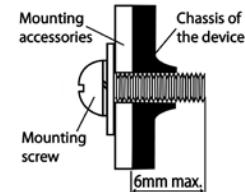


Fig. 4. Mounting Screw

1. 安全規範

- 與通風表面保持至少 20mm 的安全距離，以確保對流冷卻充分。
- 本產品不適合擺放在低熱導體，例如：塑膠。
- 受環境溫度及產品負載的影響，本機外殼溫度會很高，因此在上電時或切斷電源後短時間內不要觸摸本機，以免燙傷。
- 請勿在上電時觸摸連接端子，以防電擊危險。
- 安裝過程中，應避免金屬元件或金屬導體通過空隙或通風孔進入到產品內，否則會引起下列狀況。— 電擊；安全危害；火災；產品異常
- 警告：在連接產品電源供應時，產品必須先接地然後才接 L 和 N。
當要解開電源供應時，必須先把 L 和 N 解開然後才把接地解開。

2. 產品外觀介紹

依據圖一：

- ① 輸入/輸出連接端子
- ② 直流電壓調節電位器
- ③ 直流電控制 OK 指示燈（綠色）

3. 產品固定方式

依據圖二：

- Ⓐ 在把產品安裝在固定表面時，將螺絲鎖入此固定孔。產品應該用長度至少 4mm 的 M3 螺絲鎖入至少兩個固定孔。
 - Ⓑ 此固定表面為客戶系統表面。
 - Ⓒ 輸入/輸出連接端子。
- 電線的設計可使用多股或實心，AWG no.18-14。扭矩不應該超過 13Kgf.cm 剝線的長度不應該超過 0.275” 或者 7mm 依據圖三

4. 配件組合安裝

- 在把配件裝上產品時，請使用長度不超過 6mm 的 M3 螺絲鎖入產品底面的固定孔。這是為了確保螺絲和內部元件間有足夠的絕緣距離。
- 依據圖四：
建議配件固定螺絲扭矩為 4~8Kgf.cm

1. 安全规范

- 与通风表面保持至少 20mm 的安全距离，以确保对流冷却充分。
- 本产品不适合摆放在低热导体，例如：塑胶。
- 受环境温度及产品负载的影响，本机外壳温度会很高，因此在上电时或切断电源后短时间内不要触摸本机，以免烫伤。
- 请勿在上电时触摸连接端子，以防电击危险。
- 安装过程中，应避免金属元件或金属导体通过空隙或通风孔进入到产品内，否则会引起下列状况。— 电击；安全危害；火灾；产品异常
- 警告：在连接产品电源供应时，产品必须先接地然后才接 L 和 N。
当要解开电源供应时，必须先把 L 和 N 解开然后才把接地解开。

2. 产品外观介绍

依据图一：

- ① 输入/输出连接端子
- ② 直流电压调节电位器
- ③ 直流电控制 OK 指示灯（绿色）

3. 产品固定方式

依据图二：

- Ⓐ 在产品安装在固定表面时，将螺丝锁入此固定孔。产品应该用长度至少 5mm 的 M3 螺丝锁入至少两个固定孔。
 - Ⓑ 此固定表面为客户系统表面。
 - Ⓒ 输入/输出连接端子。
- 电线的设计可使用多股或实心，AWG no.18-14。扭矩不应该超过 13Kgf.cm 剥线的长度不应该超过 0.275” 或者 7mm 依据图三

4. 配件组合安装

- 在把配件装上产品时，请使用长度不超过 6mm 的 M3 螺絲鎖入產品底面的固定孔。這是為了確保螺絲和內部元件間有足夠的絕緣距離。
- 依據圖四：
建議配件固定螺絲扭矩為 4~8Kgf.cm

1. Safety Instructions

- To ensure sufficient convection cooling, always maintain a safety distance of ≥ 20 mm from all ventilated surfaces while the device is in operation.
- The device is not recommended to be placed on low thermal conductive surface, for example, plastics.
- Note that the enclosure of the device can become very hot depending on the ambient temperature and load of the power supply. Do not touch the device while it is in operation or immediately after power is turned OFF. Risk of burning!
- Do not touch the terminals while power is being supplied. Risk of electric shock.
- Prevent any foreign metal, particles or conductors to enter the device through the openings during installation. It can cause: Electric shock; Safety Hazard; Fire; Product failure
- Warning: When connecting the device, secure Earth connection before connecting L and N. When disconnecting the device, remove L and N connections before removing the Earth connection.

2. Device Descriptions

Refer to Fig. 1.:

- ① Input & Output terminal block connector
- ② DC voltage adjustment potentiometer
- ③ DC OK control LED (Green)

3. Installation of the Device

Refer to Fig. 2.:

- Ⓐ Mounting holes for power supply assembly onto the mounting surface. The power supply shall be mounted on minimum 2 mounting holes using M3 screw minimum 5 mm length.
- Ⓑ This surface belongs to customer's end system or panel where the power supply is mounted.
- Ⓒ Connector

- Use flexible cable (stranded or solid), AWG No. 22-12. The torque at the Connector shall no exceed 13 Kgf.cm. The insulation stripping length should not exceed 0.275" or 7 mm (Refer to Fig. 3).

4. Installation of Mounting Accessories

Refer to Fig. 4.:

- Only use M3 screw ≤ 6 mm through the base mounting holes. This is to keep a safe distance between the screw and internal components.
- Recommended mounting tightening torque: 4~8 Kgf.cm



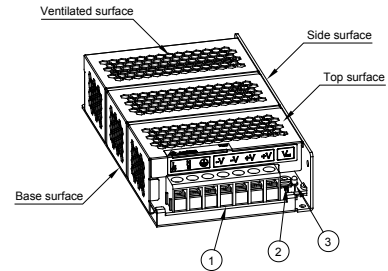


Fig. 1. Device Descriptions

Side Mounting (Vertical)



Base Mounting (Vertical)

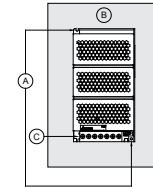

Side Mounting (Horizontal)


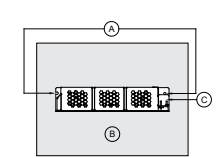


Fig. 2. Mounting Orientation



Lug



Stripped wire

Fig. 3. Wire Type

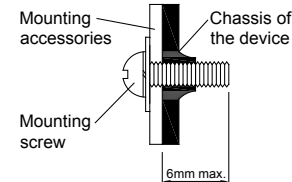


Fig. 4. Mounting Screw

1. 安全规范

- 与通风表面保持至少 20 mm 的安全距离，以确保对流冷却充分。
- 本产品不适合摆放在低热导体，例如：塑胶。
- 受环境温度及产品负载的影响，本机外壳温度会很高，因此在上电时或切断电源后短时间内不要触摸本机，以免烫伤。
- 请勿在上电时触摸连接端子，以防电击危险。
- 安装过程中，应避免金属元件或金属导体通过空隙或通风孔进入到产品内，否则会引起下列状况。
 - 一电击；安全危害；火灾；产品异常
- 警告：在连接产品电源供应时，产品必须先接地然后才接 L 和 N。当要解开电源供应时，必须先把 L 和 N 解开然后才把接地解开。

2. 产品外观介绍

依据图一：

- ① 输入/输出连接端子
- ② 直流电压调节电位器
- ③ 直流电控制 OK 指示灯（绿色）

3. 产品固定方式

依据图二：

- Ⓐ 在把产品安装在固定表面时，将螺丝锁入此固定孔。产品应该用长度至少 5 mm 的 M3 螺丝锁入至少两个固定孔。
- Ⓑ 此固定表面为客户系统表面。
- Ⓒ 输入/输出连接端子。

- 电线的设计可使用多股或实心，AWG No. 22-12。扭矩不应该超过 13 Kgf.cm 剥线的长度不应该超过 0.275" 或者 7 mm (依据图三)。

4. 配件组合安装

依据图四：

- 在把配件装上产品时，请使用长度不超过 6 mm 的 M3 螺丝锁入产品底面的固定孔。这是为了确保螺丝和内部元件间有足够的绝缘距离。
- 建议配件固定螺丝扭矩为 4~8 Kgf.cm

1. 安全上の注意

- 電源装置を十分に冷却するため、運転中はすべての通気面の周囲に 20 mm 以上のスペースを保ってください。
- 本装置を低熱伝導面（例：プラスチック）に設置することは避けて下さい。
- 電源装置の周囲を囲うと、周囲温度や電源の負荷によって非常に熱くなることがありますので注意して下さい。電源装置の運転中やパワーをオフにした直後は、装置に触れないで下さい。やけどの恐れがあります。
- 電源運転中はターミナルに触らないで下さい。感電の危険があります。
- 装置を箱から出してから設置するまでの間、金属の異物や導電体が装置の中に入らないようにして下さい。こうした異物は、感電、火事、装置の故障を引き起こす危険があります。
- 警告！ 電源装置の配線時、L と N をつなぐ前にアースにつなぐこと。装置をはずす際、アース接続をはずす前に、L と N の接続をはずすこと。

2. 電源装置の各部名称

図 1 参照：

- ① 入出力端子ブロック
- ② 出力微調整ボリューム
- ③ 出力モニター用 LED 指示灯（グリーン色）

3. 電源装置の設置

図 2 参照：

- Ⓐ 設置相手の装着面に電源の取付け穴を合わせます。M3 のネジを使用し、最低 5 mm の深さに達するまで、2 箇所以上で固定して下さい。
- Ⓑ この面は、電源装置を固定する側のシステムないしはパネル面です。
- Ⓒ 入出力端子です。

- AWG No. 22-12 を使用して接続して下さい。コネクターへの締め付けトルクは 13 Kgf.cm 以内、ケーブル皮膜の除去は 0.275" (7 mm) 以内として下さい（図 3 参照）

4. 設置の際の注意

図 4 参照：

- 外部機器への装着時は、必ず M3 を使用し、内部回路への安全距離を保つため 6 mm を越えない深さで固定して下さい。
- 装着時の締め付けトルクは 4~8 Kgf.cm を推奨いたします。

1. Safety Instructions

- To ensure sufficient convection cooling, always maintain a safety distance of ≥ 20 mm from all ventilated surfaces while the device is in operation.
- The device is not recommended to be placed on low thermal conductive surface, for example, plastics.
- Note that the enclosure of the device can become very hot depending on the ambient temperature and load of the power supply. Do not touch the device while it is in operation or immediately after power is turned OFF. Risk of burning!
- Do not touch the terminals while power is being supplied. Risk of electric shock.
- Prevent any foreign metal, particles or conductors to enter the device through the openings during installation. It can cause: Electric shock; Safety Hazard; Fire; Product failure
- Warning: When connecting the device, secure Earth connection before connecting L and N. When disconnecting the device, remove L and N connections before removing the Earth connection.

2. Device Descriptions

Refer to Fig. 1.:

- ① Input & Output terminal block connector
- ② DC voltage adjustment potentiometer
- ③ DC OK control LED (Green)

3. Installation of the Device

Refer to Fig. 2.:

- Ⓐ Mounting holes for power supply assembly onto the mounting surface. The power supply shall be mounted on minimum 2 mounting holes using M3 screw minimum 5 mm length.
- Ⓑ This surface belongs to customer's end system or panel where the power supply is mounted.
- Ⓒ Connector

- Use flexible cable (stranded or solid), AWG No. 18-14. The torque at the Connector shall no exceed 13 Kgf.cm. The insulation stripping length should not exceed 0.275" or 7 mm (Refer to Fig. 3).

4. Installation of Mounting Accessories

Refer to Fig. 4.:

- Only use M3 screw ≤ 6 mm through the base mounting holes. This is to keep a safety distance between the screw and internal components.
- Recommended mounting tightening torque: 4~8 Kgf.cm.

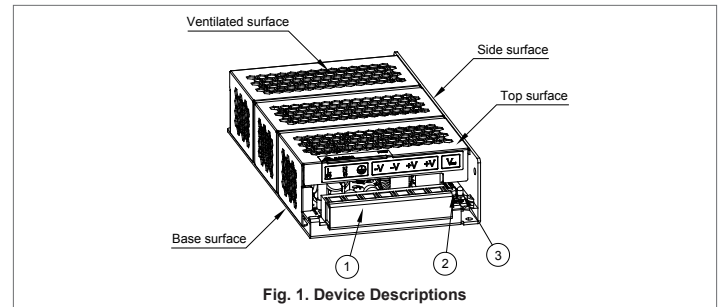


Fig. 1. Device Descriptions

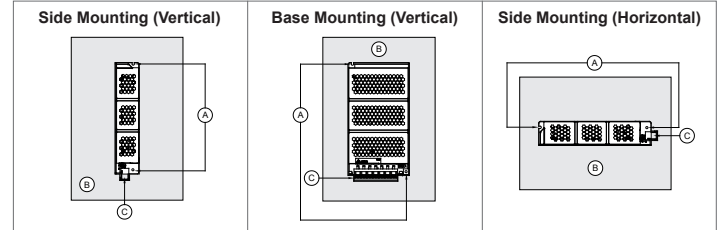


Fig. 2. Mounting Orientation

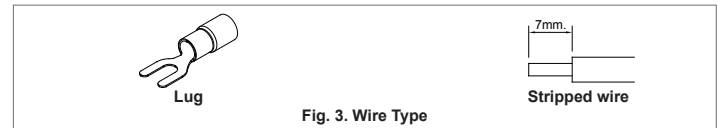


Fig. 3. Wire Type

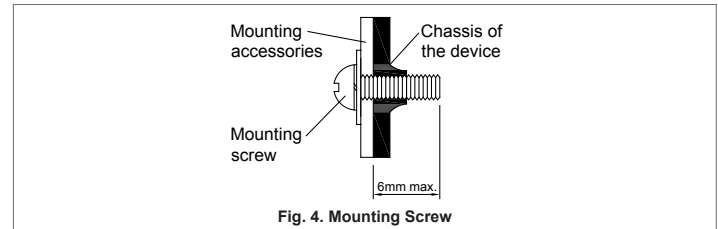


Fig. 4. Mounting Screw

1. 安全規範

- 與通風表面保持至少 20 mm 的安全距離，以確保對流冷卻充分。
- 本產品不適合擺放在低熱導體，例如：塑膠。
- 受環境溫度及產品負載的影響，本機外殼溫度會很高，因此在上電時或切斷電源後短時間內不要觸摸本機，以免燙傷。
- 請勿在上電時觸摸連接端子，以防電擊危險。
- 安裝過程中，應避免金屬元件或金屬導體通過空隙或通風孔進入到產品內，否則會引起下列狀況。
 - 一電擊;安全危害;火災;產品異常
- 警告: 在連接產品電源供應時，產品必須先接地然後才接 L 和 N。
當要解開電源供應時，必須先把 L 和 N 解開然後才把接地解開。

2. 產品外觀介紹

依據圖一：

- ① 輸入/輸出連接端子
- ② 直流電壓調節電位器
- ③ 直流電控制 OK 指示燈（綠色）

3. 產品固定方式

依據圖二：

- Ⓐ 在把產品安裝在固定表面時，將螺絲鎖入此固定孔。產品應該用長度至少 5 mm 的 M3 螺絲鎖入至少兩個固定孔。
 - Ⓑ 此固定表面為客戶系統表面。
 - Ⓒ 輸入/輸出連接端子。
- 電線的設計可使用多股或實心，AWG No. 18-14。扭矩不應該超過 13 Kgf.cm 剝線的長度不應該超過 0.275" 或者 7 mm (依據圖三)。

4. 配件組合安裝

依據圖四：

- 在把配件裝上產品時，請使用長度不超過 6 mm 的 M3 螺絲鎖入產品底面的固定孔。這是為了確保螺絲和內部元件間有足夠的絕緣距離。
- 建議配件固定螺絲扭矩為 4~8 Kgf.cm。

1. 安全规范

- 与通风表面保持至少 20 mm 的安全距离，以确保对流冷却充分。
- 本产品不适合摆放在低热导体，例如：塑胶。
- 受环境温度及产品负载的影响，本机外壳温度会很高，因此在上电时或切断电源后短时间内不要触摸本机，以免烫伤。
- 请勿在上电时触摸连接端子，以防电击危险。
- 安装过程中，应避免金属元件或金属导体通过空隙或通风孔进入到产品内，否则会引起下列状况。
 - 一电击;安全危害;火灾;产品异常
- 警告: 在连接产品电源供应时，产品必须先接地然后才接 L 和 N。
当要解开电源供应时，必须先把 L 和 N 解开然后才把接地解开。

2. 产品外观介绍

依据图一：

- ① 输入/输出连接端子
- ② 直流电压调节电位器
- ③ 直流电控制 OK 指示灯（绿色）

3. 产品固定方式

依据图二：

- Ⓐ 在把产品安装在固定表面时，将螺丝锁入此固定孔。产品应该用长度至少 5 mm 的 M3 螺丝锁入至少两个固定孔。
 - Ⓑ 此固定表面为客户系统表面。
 - Ⓒ 输入/输出连接端子。
- 电线的设计可使用多股或实心，AWG No. 18-14。扭矩不应该超过 13 Kgf.cm 剥线的长度不应该超过 0.275" 或者 7 mm (依据图三)。

4. 配件组合安装

依据图四：

- 在把配件装上产品时，请使用长度不超过 6 mm 的 M3 螺丝锁入产品底面的固定孔。这是为了确保螺丝和内部元件间有足够的绝缘距离。
- 建议配件固定螺丝扭矩为 4~8 Kgf.cm。